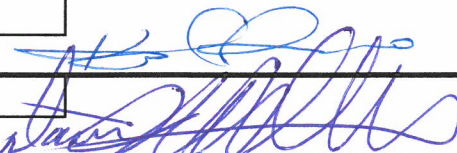



Idaho PUC Pipeline Safety Inspection Summary

Inspector(s):	Perkins/Russo	Date(s):	3-Feb-20
Company/Owner:	Intermountain Gas Company	Unit/OPID:	8160
Inspection Type & Time (1 day)	Total Inspection Days:		2
Standard: <input type="checkbox"/>	Construction: <input checked="" type="checkbox"/> 2	Training: <input type="checkbox"/>	(T)(D) Integrity Management: <input type="checkbox"/> Incident: <input type="checkbox"/>
M/M: <input type="checkbox"/>	Follow-up: <input type="checkbox"/>	OQ: <input type="checkbox"/>	Damage Prevention: <input type="checkbox"/> D&A: <input type="checkbox"/>
Inspection Summary			
<p>A construction inspection was performed on Intermountain Gas Company crew in Parma, Idaho</p> <p>Feb 3 2020: (1.0 Construction)</p> <p>Observed Intermountain Gas performing a cutout and replacement of a section of 2" steel main that had been previously damaged by an unidentified excavator. We witnessed them scrape and collect the pipe wrap/coating and prep the steel to weld on 2, 2" fittings to tap and plug the main. They preheated the main before welding and verified the preheat temps using a pyrometer. After welding on the fittings, they air tested them to check for leaks. They then tapped the main at both fittings and plugged it using bypass plugs to allow them to bypass and isolate the damaged section of main to be cutout. We broke for lunch and arrived back on site to them having the damaged section already cut out and new pipe being welded in. Once finished they gassed up the new section of main, soaped the welds, removed the plugging machines and inserted the completion plugs. We left while they were preparing the main to weld on the 2" top tap tee and transition fitting to tie in the new 2" PE service that was previously installed by Dasco. Dave Call (IGC meter inspector) was also on site to set the new 5# rotary meter at the new service meter location. We did not witness any coating or backfilling at completion of the project.</p> <p>Attachments: IPUC Form 4 Construction Inspections Itineraries located in file for the project. OQ's for all observed employees are located in file for the project.</p>			
Corrective Action Required:		Follow-up Required:	
Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Inspector (Lead):		Date:	
Kyle Russo 		2/3/2020	
Reviewer:		Date:	
		5 Feb 2020	